

Space Shuttle Lessons Learned Knowledge Sharing Forum


NASA KSC Lesson Learn Entry: 3236 Solid Rocket Booster (SRB) Flame Trench Refractory Failure Modes

**Gabor Tanacs
Armand Gosselin
USA L&RS Engineering
January 27, 2011**

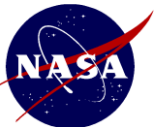

Problem Definition

- During the launch of STS-124, over 3,500 of the 22,000 interlocking refractory bricks that line the east wall of the SRB Flame Trench were liberated from Pad 39A
- The STS-124 launch anomaly generated an agency-wide initiative in order to determine root cause, assess vehicle safety, ground support equipment (GSE) safety and reliability, and to determine corrective action
- The investigation encompassed:
 - Radar imaging
 - Infrared video review
 - Debris transport evaluation
 - Computational fluid dynamics (CFD)
 - Non-destructive evaluation (NDE)
 - Analysis in order to validate the corrective action

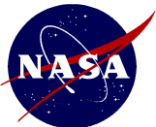


Date
File Name




Page 2



Space Shuttle Launch and Systems

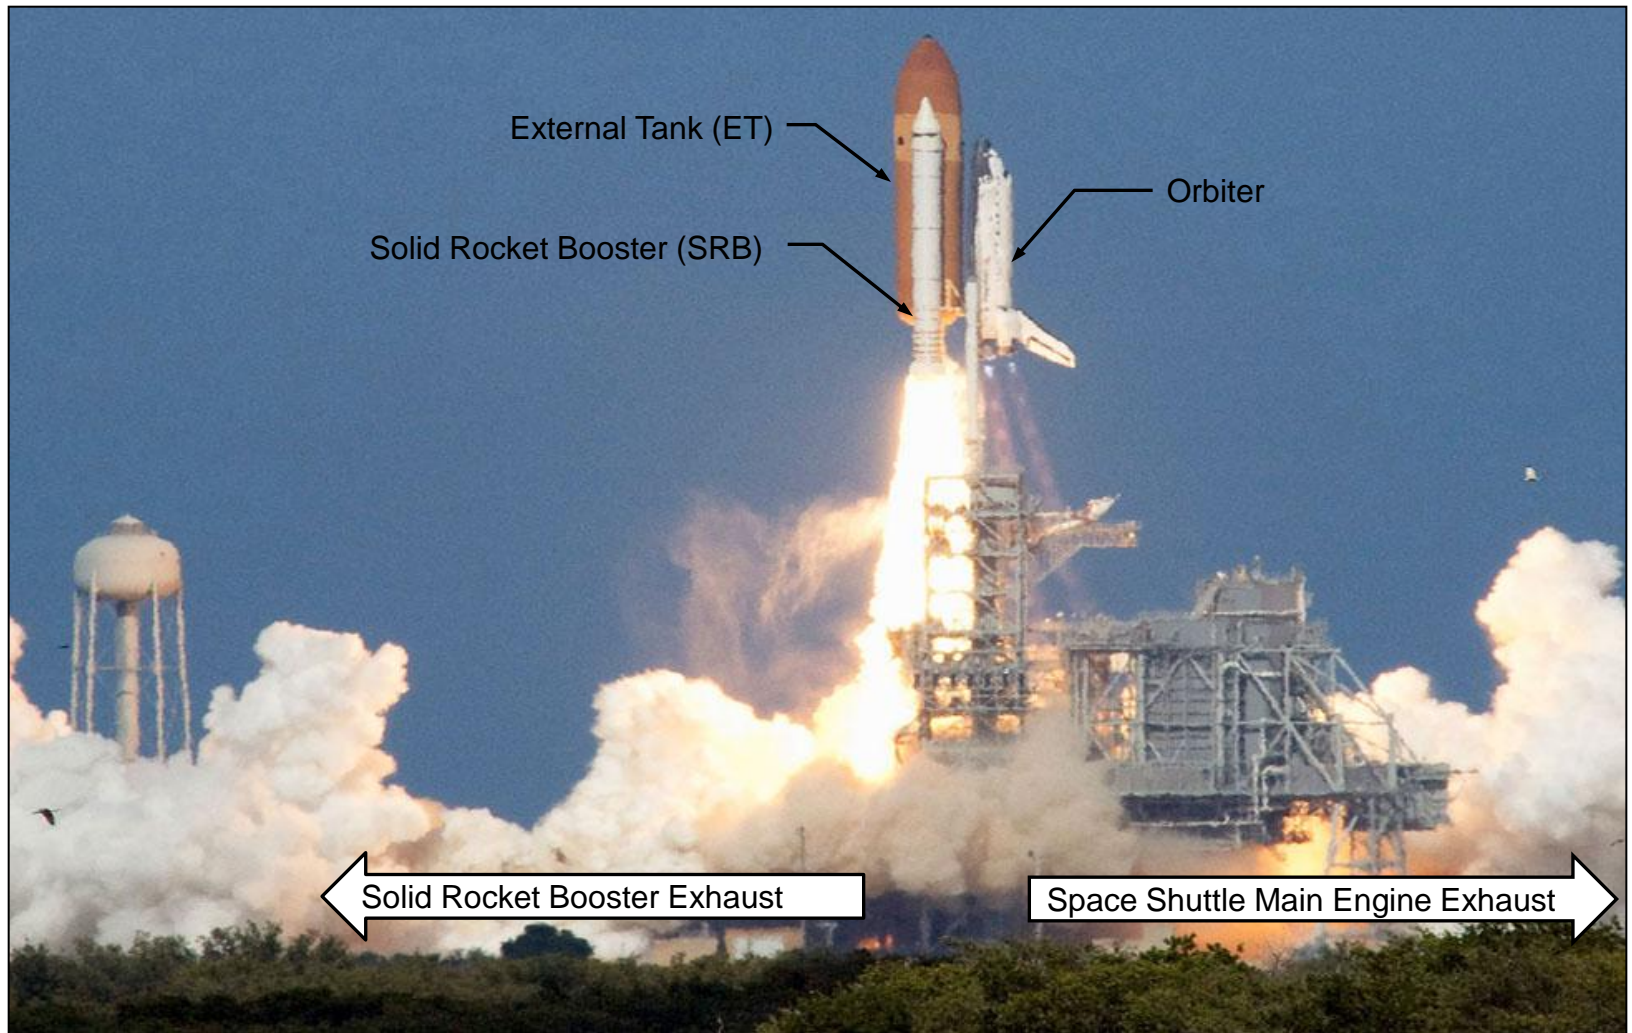


Complex 39, Launch Pad Flame Trench Configuration

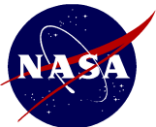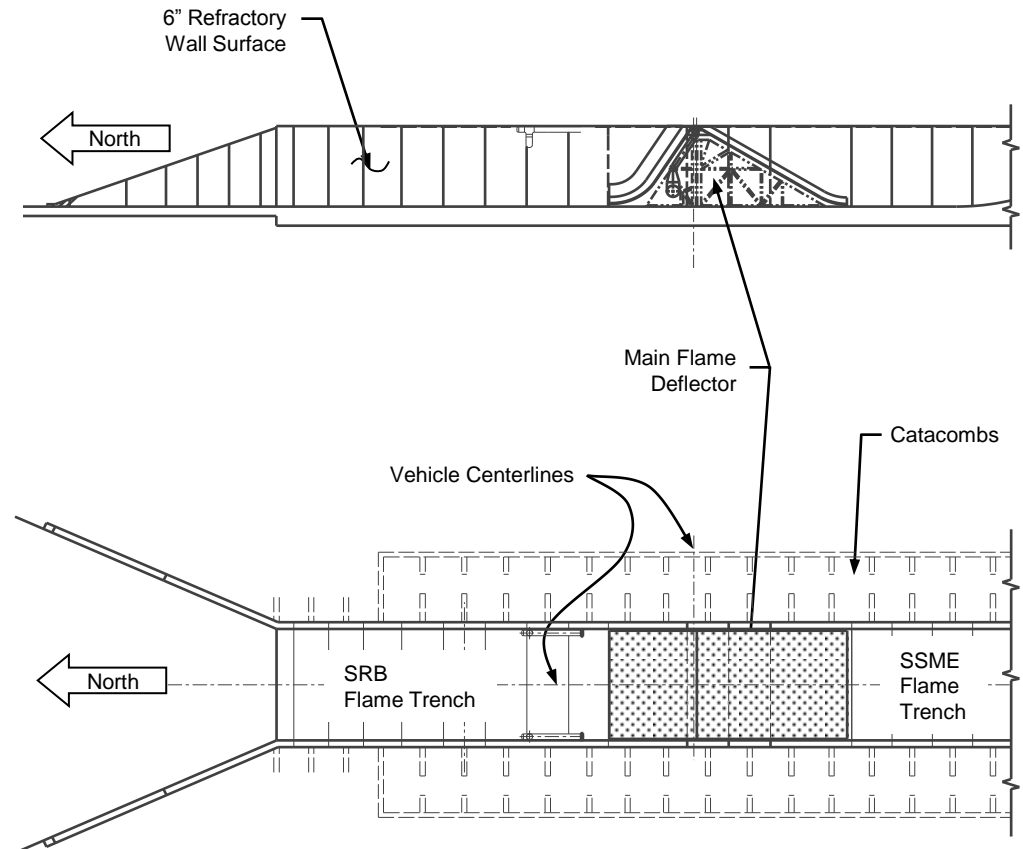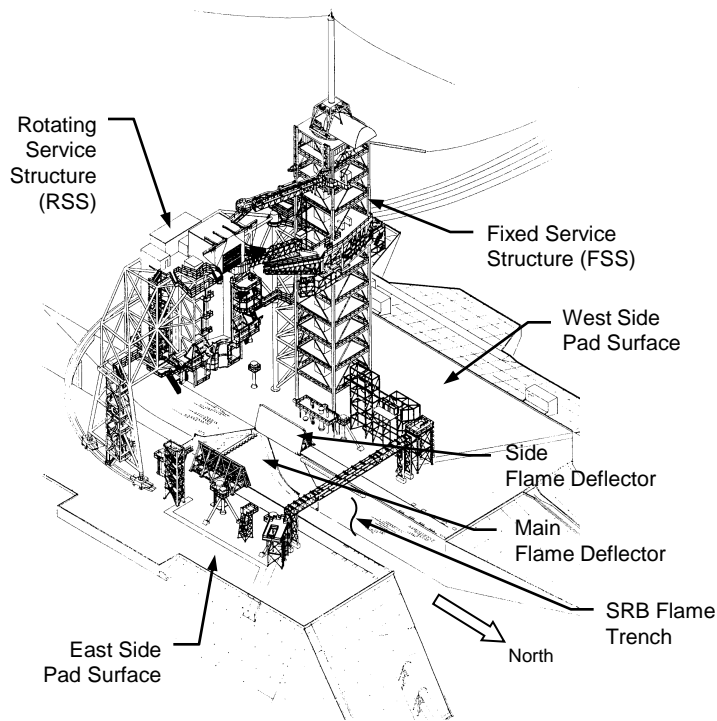


Date
File Name


Launch Complex 39 Pad A SRB Flame Trench – Looking South

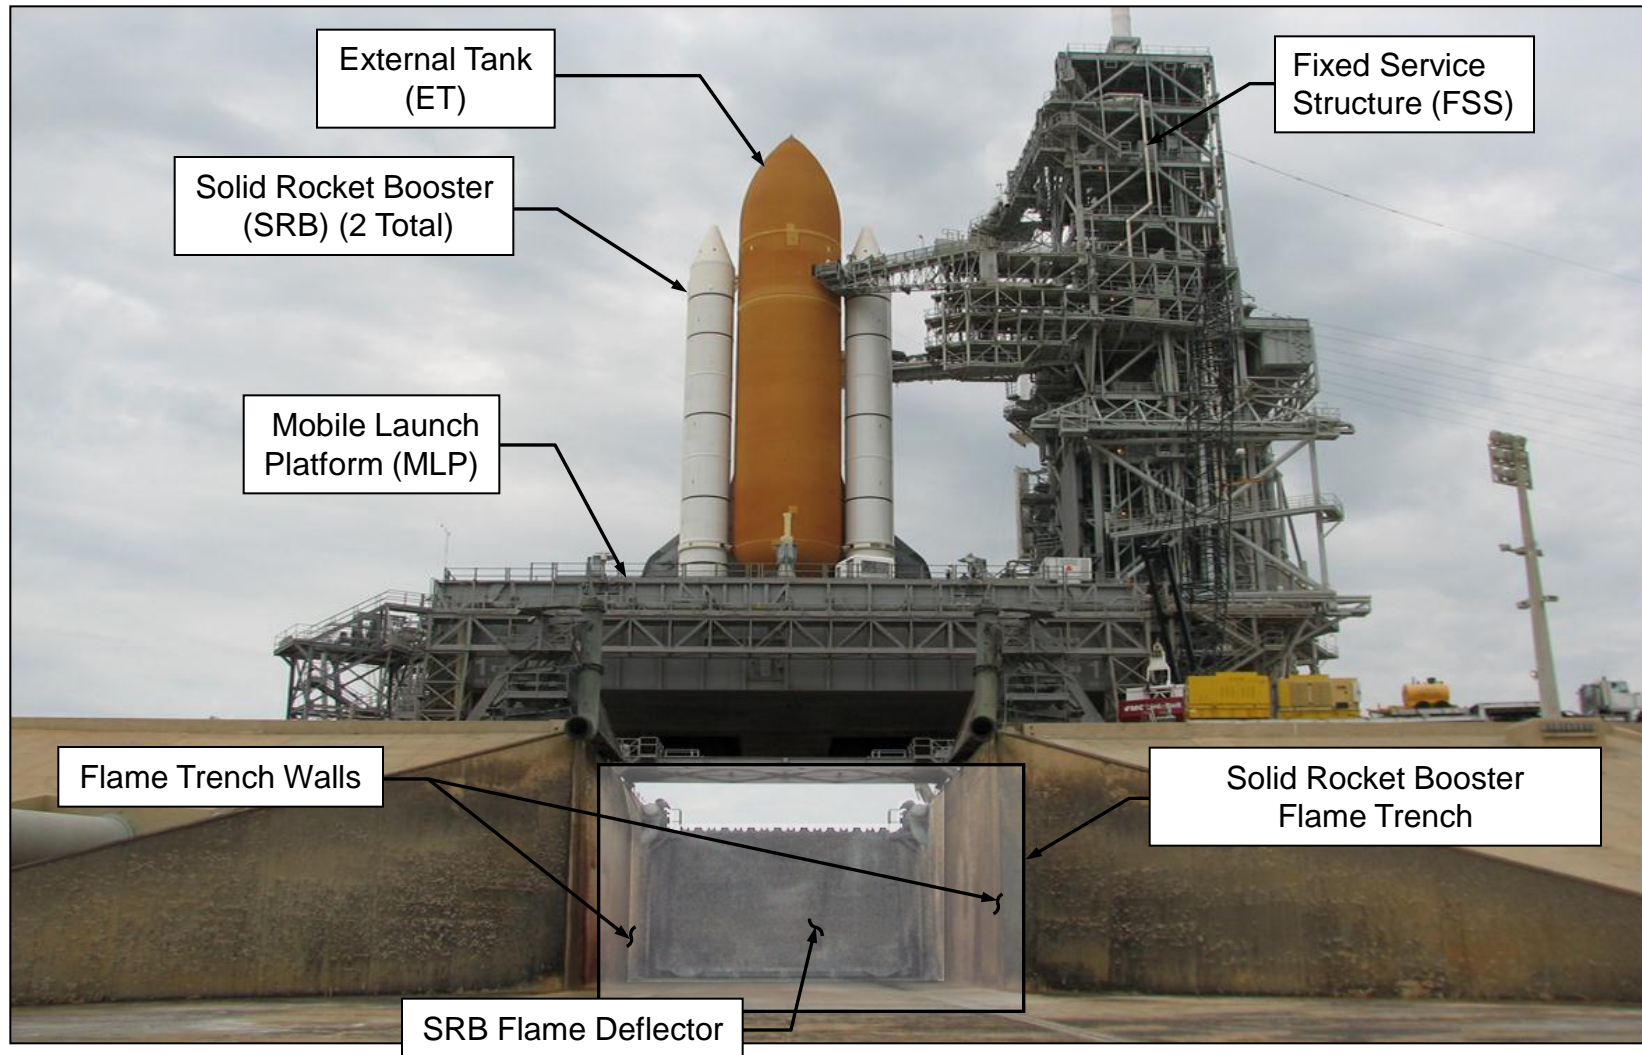

Complex 39, Pad A Flame Trench Construction ~ 1964


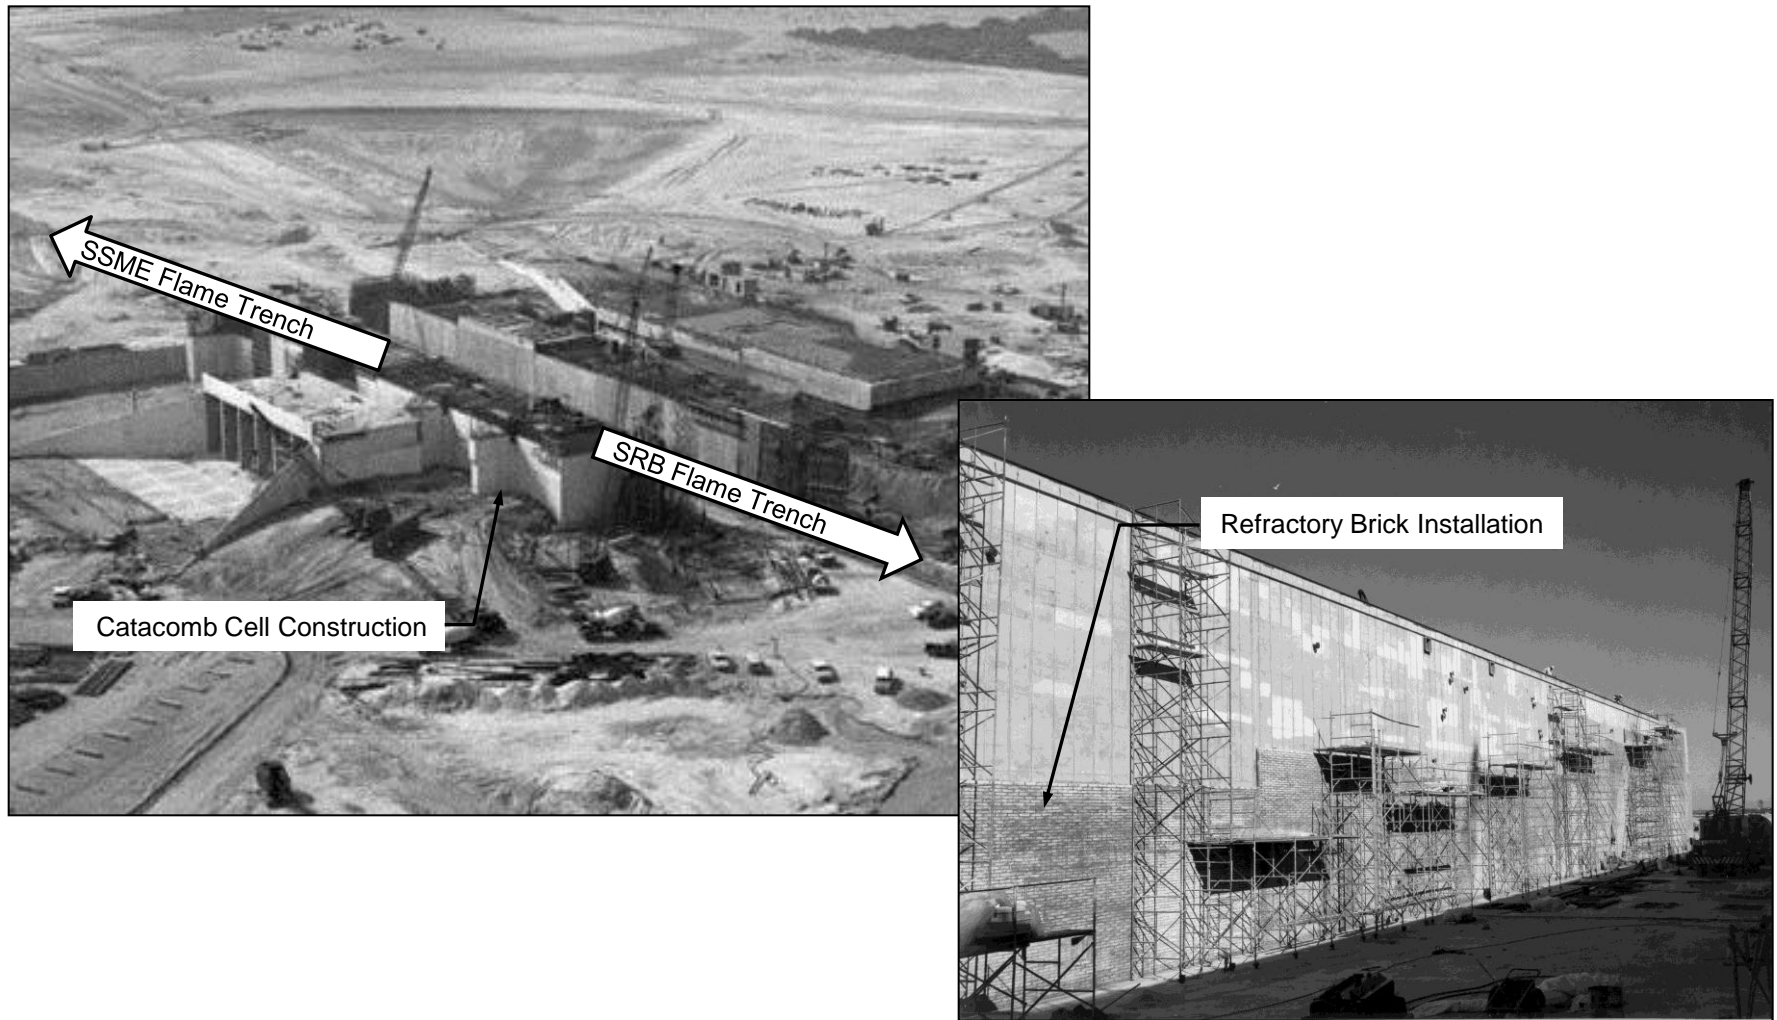


Flame Trench Wall Refractory Brick Configuration

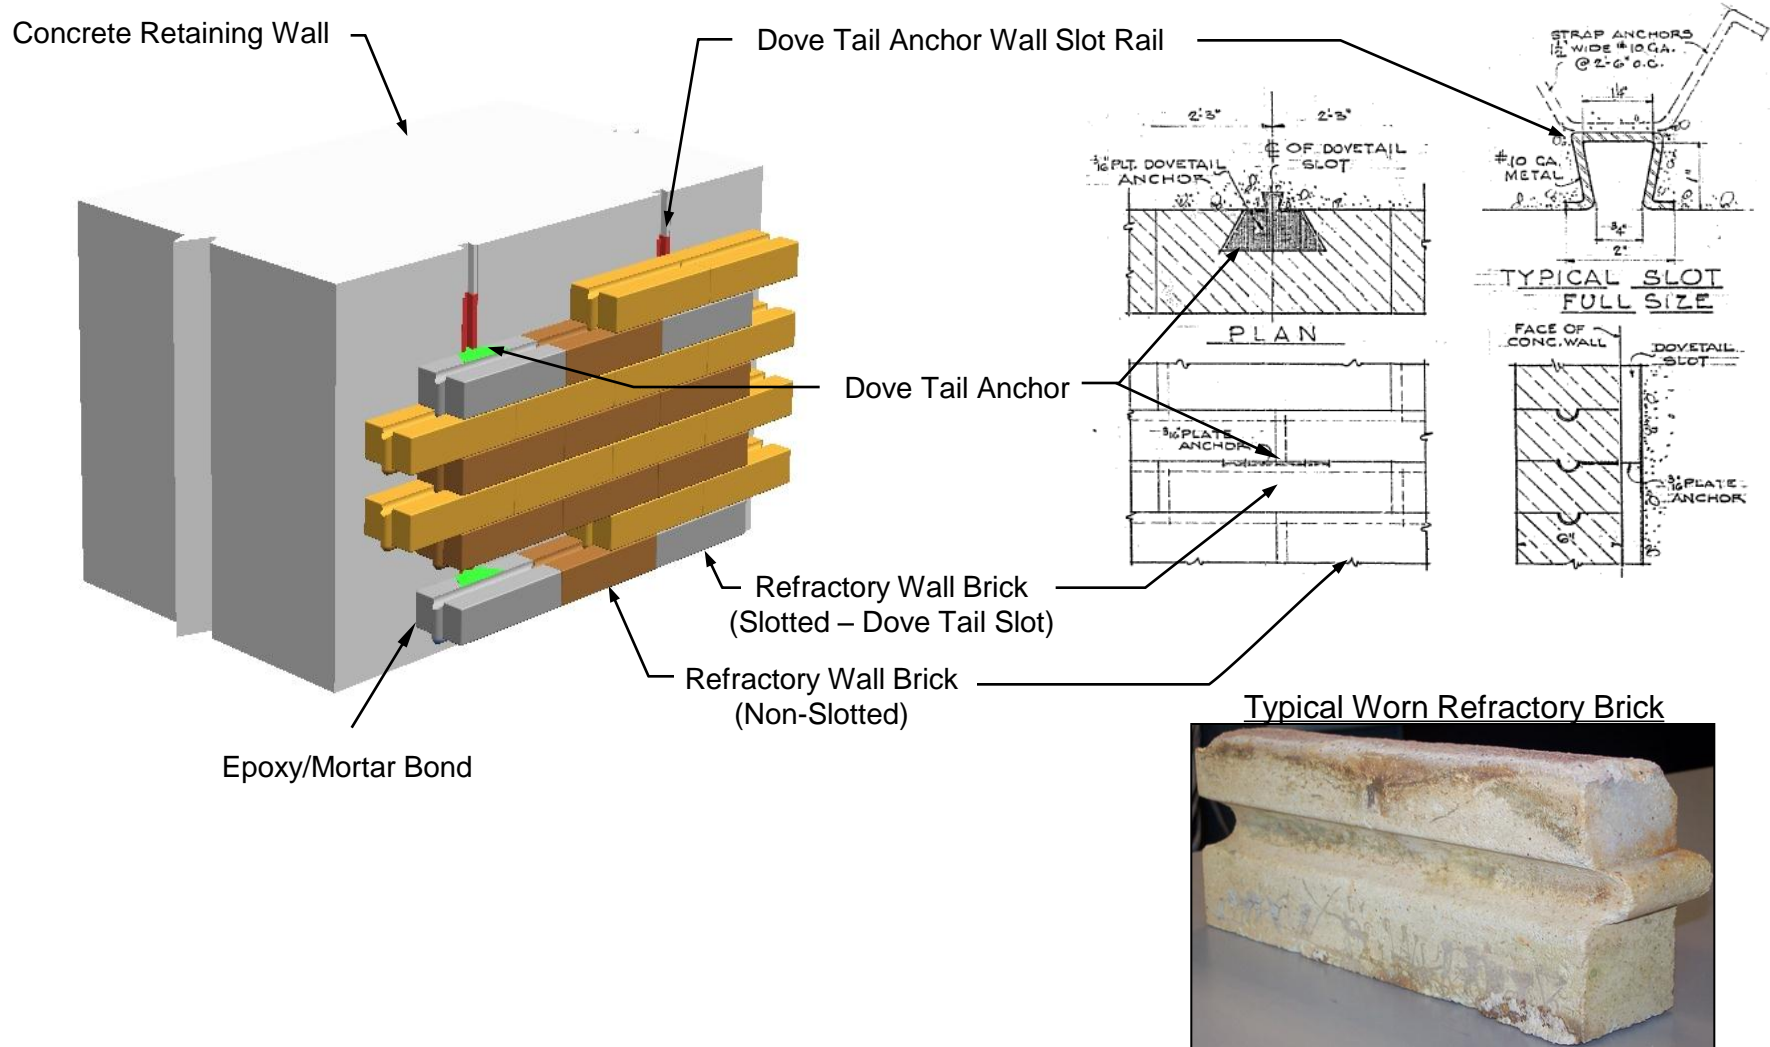

Flame Trench East Wall Damaged Area

- East Brick Wall Damage
 - Estimated Total Bricks On East Wall ~ 22,000
 - Estimated Lost Bricks ~ 3,540 (16% Loss of East Wall)

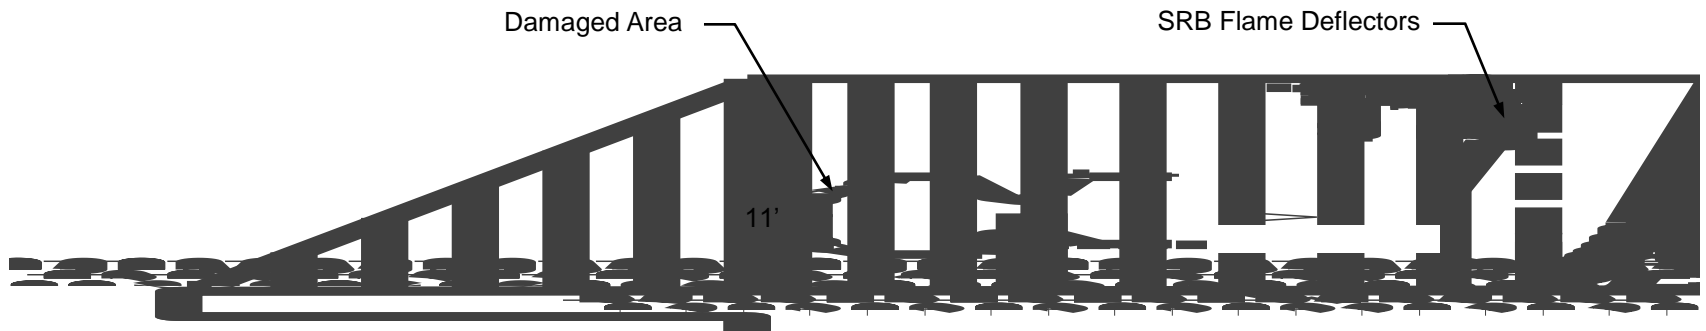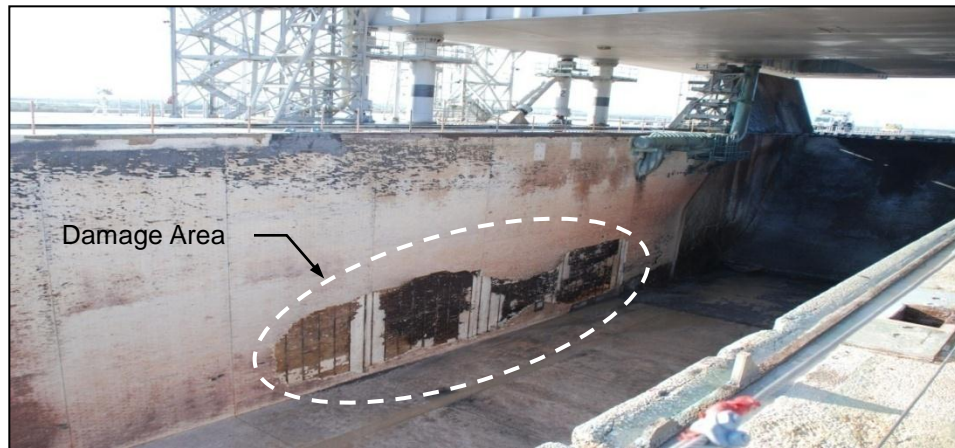

Brick Impact Mapping

- Perimeter Fence Damage
 - Fence at ~1800 ft from damage initiation
- Bricks Beyond Perimeter Fence



Flow Direction
↑




Flow Direction
↙



Flow Direction
↗

Description of Driving Event

- Radar tracking showed some of the bricks were ejected at about 680 mph but, because of their location and direction of travel, did not damage flight hardware
- An inspection found that:
 - The dovetail anchor plates and metal wall slot rails used to secure the refractory bricks to the concrete back wall were heavily corroded
 - Mortar between brick joints had eroded
 - The epoxy applied to help secure the bricks to the wall was degraded
- When the pad catacomb walls were constructed in the '60s imperfections in the straightness of the concrete surface were fixed using a mortar skim mix to which the epoxy was applied
 - This mortar skim mix contributed to the de-bonding

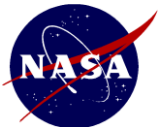


Date
File Name

Page 10




Description of Driving Event (continued)

- **Brick-to-Wall Bond Failure**
 - **Dovetail Anchor Plate Corrosion**
 - **Epoxy Degradation**

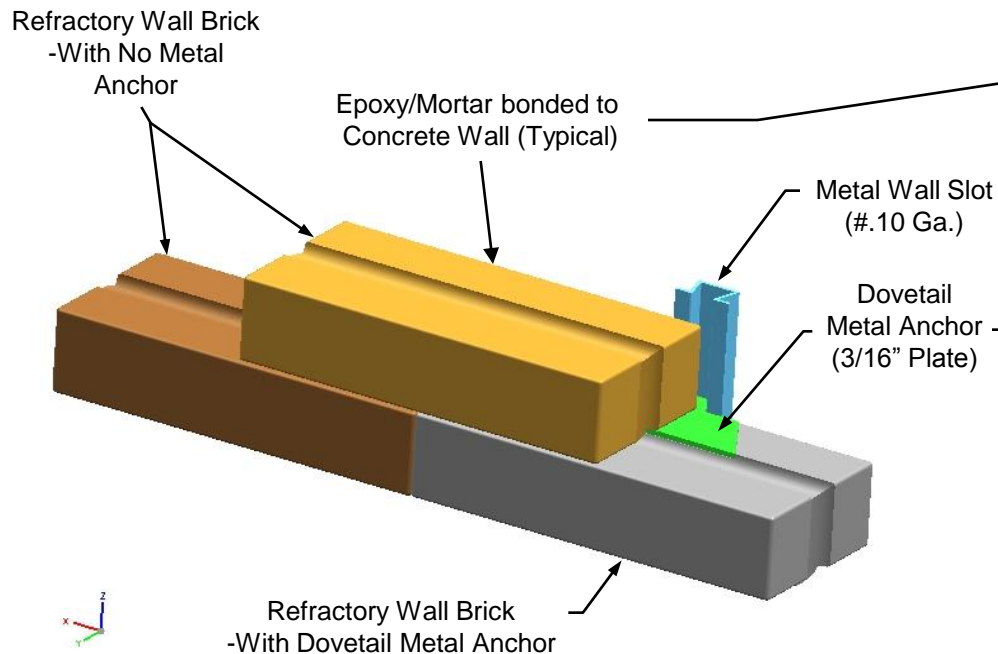

Description of Driving Event (continued)

- For years, the health of the brick portion of the flame trench was determined by measuring surface erosion
 - Surface erosion, to the point where an inch or greater of brick remained from the tongue-and-groove to the face of the brick, was considered structurally sound
 - Without other information from which to work, the condition of the metal wall ties and the epoxy could not be determined.

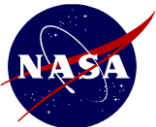


Date
File Name

Page 12



Description of Driving Event (continued)

- The flame trench refractory brick system was designed for the Saturn Apollo program, which had a liquid fuel propulsion system, and was grandfathered into use in the Shuttle program, which has a solid fuel propulsion system
 - This was done without a detailed definition of the loads and environments, an inspection plan, or a good set of calculations or assumptions derived from the Saturn design parameters
 - The liquid fuel propulsion system generated more heat because the flight vehicle was held down until enough thrust was achieved for launch
 - With the solid fuel propulsion system, the launch vehicle ascends from the pad fairly quickly; and with the water from the sound suppression system, there is less direct heat impingement

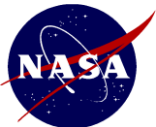


Date
File Name

Page 13



Description of Driving Event (continued)

- With the solid fuel propulsion system the overall environment is worse
 - Materials are heated, then cooled with the sound suppression water
 - The solid propellant residue (aluminum oxide) is abrasive
 - Another of its byproducts (hydrogen chloride) subjects the materials in the launch environment to a hydrochloric acid bath
 - The released water acts like a blanket to trap the acoustic energy of the SRB ignition below it, thus subjecting the materials and equipment below it to a more intense acoustic environment

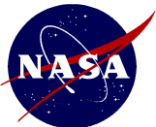


Date
File Name

Page 14



Lessons Learned

- The fact that a legacy system has never failed catastrophically does not guarantee that it will not fail in the future
- Detailed loads and environments need to be defined for design of new launch vehicle GSE and facilities
- More comprehensive inspection methods should have been used in order to detect material erosion when it was first becoming noticeable in the flame trench

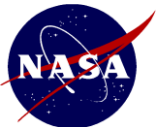


Date
File Name

Page 15



Recommendation

- Define the detailed loads and environments for future programs, and certify the flame trench systems for the launch pads that will be used with any new family of launch vehicles
- Perform a risk analysis for flame trench failure modes
- Develop inspection criteria, inspection methods, and maintenance and repair procedures for the flame trenches for both launch pads
- For a legacy system such as the flame trench
 - Obtain as much historical information and data as possible
 - Develop a test plan to validate the legacy system against new loads and environments
 - Test the performance of new types of refractory materials to see if these advancements can benefit the program

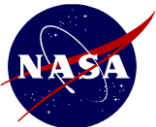



Date
File Name

Page 16



Evidence of Recurrence Control Effectiveness

- A project has been established to gather data during the remaining launches by evaluating two alternative refractory materials on a test stand attached to the SRB main flame deflector
- The Flame Trench and Main Flame Deflector have been instrumented to better understand any deltas between the predicted and actual launch environment parameters

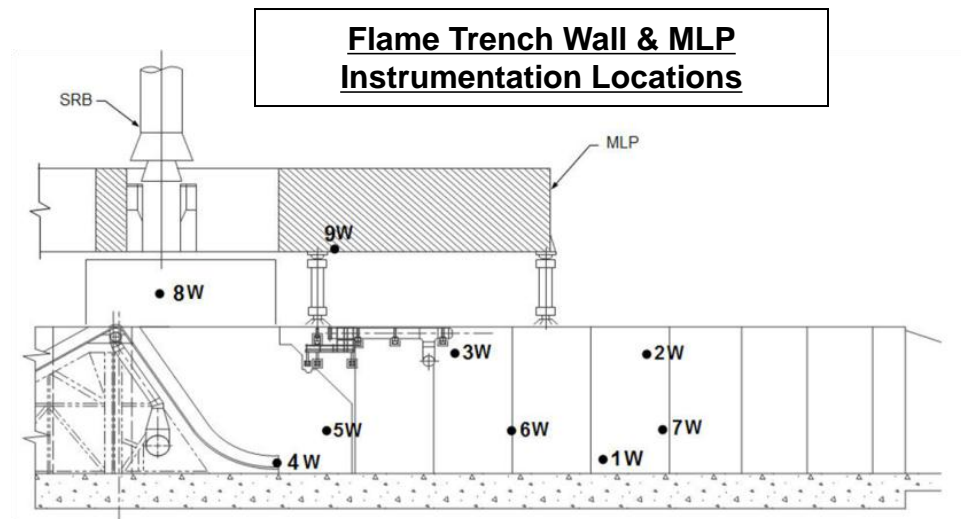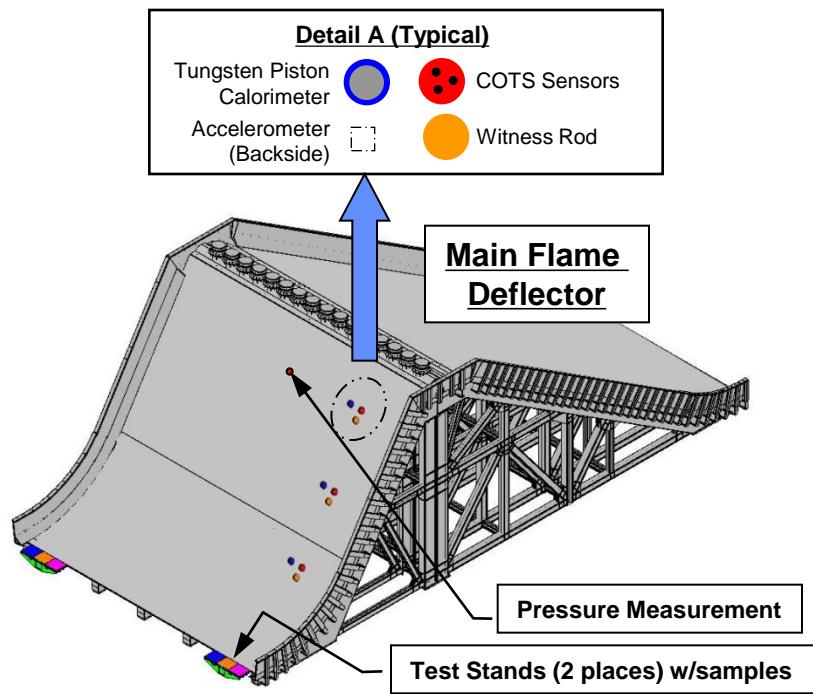

Reference Documents

- **Flame Trench Refractory Failure Modes**
 - **Lessons Learned Entry: 3236**
 - **Lesson Date: 2010-06-1**
 - **Submitting Organization: KSC**
 - **Submitted by: Annette Pitt**
 - **POC Name: Michael Olka**
 - **POC Email: Michael.H.Olka@usa-spaceops.com**
 - **POC Phone: 321-861-9581**
- **STS-124 Pad 39A Launch Damage High-Visibility Type A Mishap Out Brief**
 - **IRIS Case Number: 2008-176-00002**
 - **Date of Mishap: May 31, 2008**
 - **Presenters: Miguel A. Rodriguez, MIT Chair**
Gerald D. Schumann, Ex-Officio
 - **Date of Briefing: July 15, 2008**

